



AMP* COAXICON*
50 OHM, R.F. CONNECTORS
SERIES C PLUGS


IS 2259-1	
RELEASED	6-22-70
REVISED	12-29-81

The connectors listed below are assembled and crimped as described on Page 2.

Refer to the table below for tool Instruction Sheet numbers.

The following publications contain information on additional series C connectors.

Jacks	2259-2
Bulkhead Jacks	2259-3
Panel Jacks	2259-4
Rt. Angle Plugs	2259-5

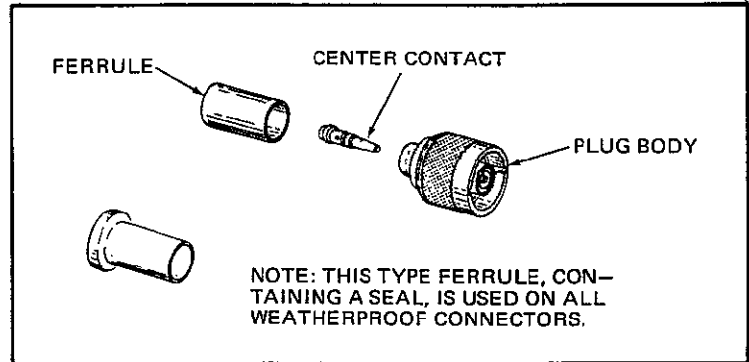

RG/U CABLE	SILVER PLATED P/N		TARNISH RES. P/N		CABLE STRIP DIM.	CRIMPING TOOL	
	Standard	Weatherproof	Standard	Weatherproof		Part No.	Instr. Sheet
8, 8A, 213	225013-6	225407-2	225671-6	225672-6	FIG. 2	220015-1	2331
9, 9A, 9B, 214	225013-5	—	225671-5	225672-5	FIG. 1	220015-1	
165	1-225013-0	225407-4	—	—	FIG. 2	220015-1	
225	1-225013-1	225407-5	—	—	FIG. 1	220015-1	
11, 11A, 144	225013-8	225407-3	—	225672-8	FIG. 2	220015-1	
393	—	—	—	1-225672-2	FIG. 1	220015-1	
216	225013-9	1-225407-1	—	—	FIG. 1	220015-1	
MICRODOT 250-4172, -4208	225013-1	225407-8	225671-1	225672-1	FIG. 2	220015-3	2336
58A, 58C	225013-3	225830-2	225671-3	225672-3	FIG. 3	220045-2	
55A, 223	—	225830-1	—	—	FIG. 3	220045-2	
303	—	—	—	1-225672-3	FIG. 3	220045-2	
142	1-225013-2	—	—	1-225672-4	FIG. 2	220045-2	

Copyright 1970, 1973 1981 by AMP Incorporated, Harrisburg, Pa. All International Rights Reserved. AMP Incorporated products covered by U.S. and Foreign Patents and/or Patents Pending.

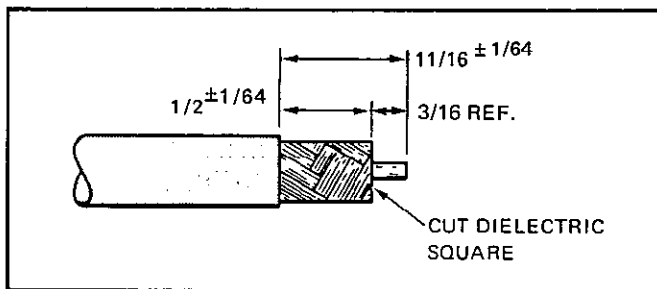


Fig. 1

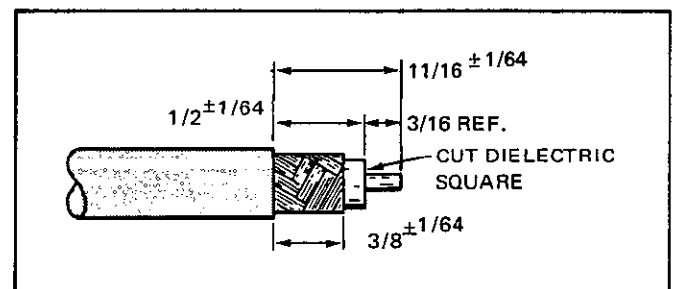


Fig. 2

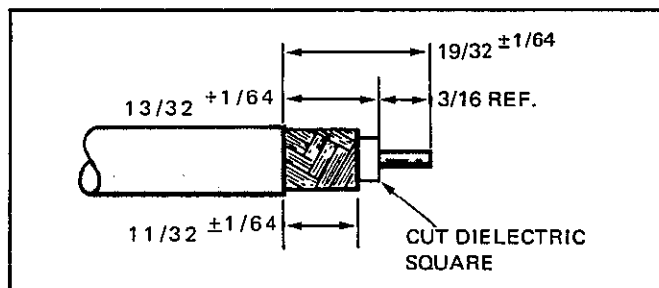


Fig. 3

TYPICAL ASSEMBLY PROCEDURE

1. Slide ferrule on cable, then strip cable. Crimp center contact (See tool instructions referenced in table).
 2. Insert contact into connector with braid over support sleeve. Pull back lightly on wire to make sure that contact is being held captive by the internal locking feature.
- NOTE:** The design of parts for smaller cables (RG 55 and 58) allows the center contact to pass beyond the internal locking feature if it is inserted with too much force. Pull back on the wire to properly locate and retain the contact in the locking feature if this condition has occurred.
3. Slide ferrule over braid and crimp ferrule. (See tool instructions referenced in table.)

