





CABLE ASSEMBLY INSTRUCTION			
SMB3100-0178	JYE BAO CO., LTD.		
A	В	С	D
BODY	CONTACT I	PIN INSULATOR	FERRULE
DIAGRAM		ASSEMBLY INSTRUCTION	
8.9 [.351] 4.5 4.4 [.177] [.173] 2.5 [.098]		Step 1: STRIP AS SHOWN .	
		Step 2: SLIDE FERRULE " D " OVER CABLE . Step 3: WRAP THE BRAIDING OVER " D ".	
6.7 [.264] D [.098]		Step 4: STRIP AS SHOWN .	
C Y B		Step 5: SLIDE PREPARED CABLE INTO INSULATOR " C " . Step 6: PUT CONTACT PIN " B " ON CENTER CONDUCTOR AND CRIMP IN " Y " .	
CRIMP "X " A		Step 7: PUT PREPARED CABLE INTO CONNECTOR BODY " A " AND CRIMP IN " X " .	

This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.