



7/16-8100-0213 7/16 Jack Crimp 50Ω

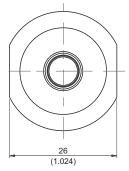

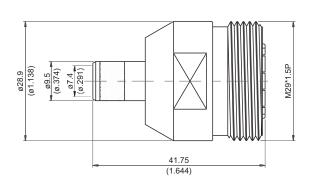

Parts	Material	Plating(Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Phosphor Bronze	Silver 150 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:

Suitable Cables: RG213

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.



CABLE ASSEMBLY INSTRUCTION 7/16-8100-0213 JYE BAO CO., LTD. В С \bigcirc BODY FERRULE CONTACT PIN ASSEMBLY INSTRUCTION DIAGRAM 21.8 [.859] Step 1: STRIP AS SHOWN. 9.1 [.359] 4.2 [.165] Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y ". Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE. Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. С

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.