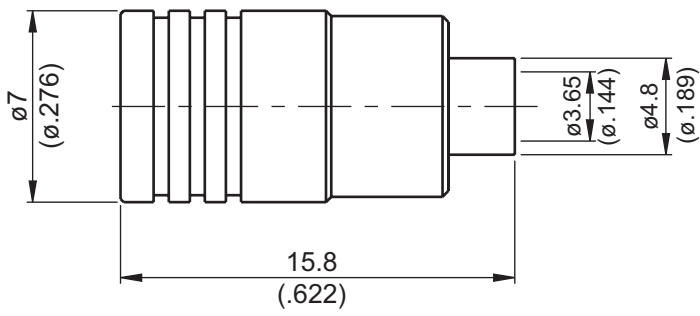


SMB3300-0141	SMB Plug Solder	50Ω															
																	
<table border="1"> <thead> <tr> <th>Parts</th> <th>Material</th> <th>Plating (Micro-inch)</th> </tr> </thead> <tbody> <tr> <td>Contact Pin</td> <td>Phosphor Bronze</td> <td>Gold 20 Over Nickel 50 Over Copper 50</td> </tr> <tr> <td>Retainer Ring</td> <td>Beryllium Copper</td> <td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td> </tr> <tr> <td>Insulator</td> <td>Teflon</td> <td></td> </tr> <tr> <td>Body</td> <td>Brass</td> <td>Gold 5 Over Nickel 50 Over Copper 50</td> </tr> </tbody> </table>	Parts	Material	Plating (Micro-inch)	Contact Pin	Phosphor Bronze	Gold 20 Over Nickel 50 Over Copper 50	Retainer Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Insulator	Teflon		Body	Brass	Gold 5 Over Nickel 50 Over Copper 50		
Parts	Material	Plating (Micro-inch)															
Contact Pin	Phosphor Bronze	Gold 20 Over Nickel 50 Over Copper 50															
Retainer Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50															
Insulator	Teflon																
Body	Brass	Gold 5 Over Nickel 50 Over Copper 50															
<p>Weight: 1.78 g Suitable Cables: Semi-rigid.141</p>																	

This part number complies with RoHS.


Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

SMB3300-0141

JYE BAO CO., LTD.

A



BODY

B




CONTACT PIN

DIAGRAM


ASSEMBLY INSTRUCTION



Step 1: STRIP AS SHOWN .

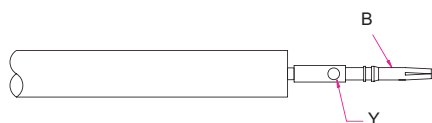

Step 2: INSERT CABLE'S CENTER CONDUCTOR INTO CONTACT PIN " B " AND SOLDER IN " Y " .

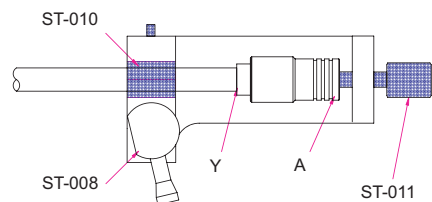

Step 3: INSERT PREPARED CABLE INTO SOLDERING FIXTURE " ST-008 " . USE INSERT TOOL " ST-010 " AND LOCATOR TOOL " ST-011 " TO FIX THE CONNECTOR . SOLDER IN " Y " .

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.