



Globespan HDSL recommendations


EP13 - SMD

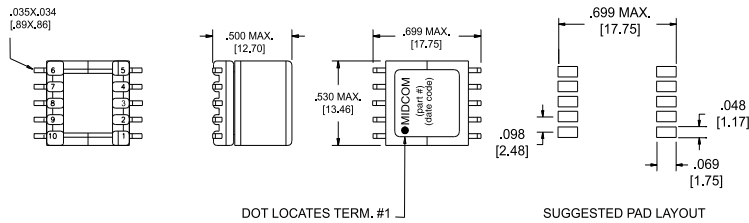

EP13 - TH

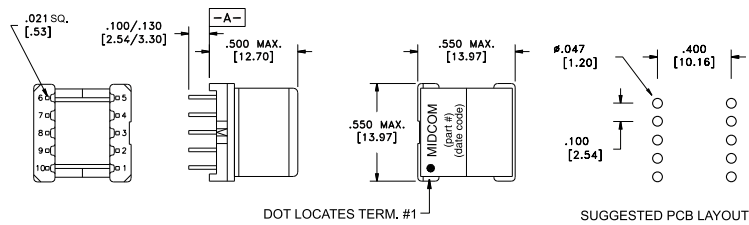

EPX9 - SMD

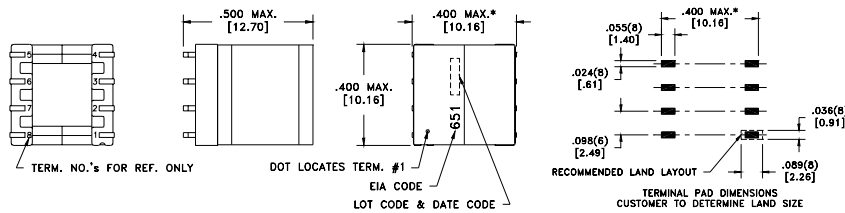

Part Number	Application	Turns Ratio PRI:SEC	Safety Agency	Mechanicals	Schematic
51576R	Orion IDSL	5.4:1	IEC950	EP13 - SMD	3
50517R	Analog front end	2:1	IEC950	EP13 - SMD	1
50516	Analog front end	2:1	IEC950	EP13 - TH	2
50711R	HDSL2	2:1	IEC950	EP13 - SMD	1
50864R	HDSL2	2.2:1	IEC950	EP13 - SMD	4
51081R	MDSL	4:1	IEC950	EP13 - SMD	3
50835	MDSL	4:1	IEC950	EP13 - TH	3
51074R	IDSL	4:1	IEC950	EP13 - SMD	3
51128R	HDSL2	5.4:1	IEC950	EP13 - SMD	3
51160	HDSL2	5.4:1	IEC950	EP13 - TH	3
51075R	IDSL-M2B1Q	2:1	IEC950	EP13 - SMD	3
51197R	MSDL-HMS	1.4:1	IEC950	EP13 - SMD	1
51166R	g.SHDSL	4:1	IEC950	EP13 - SMD	3
51719R	Octane SHDSL	0.7:1	IEC950	EPX9-SMD	5

Features

- Compatible with Globespan chip sets
- Good total harmonic distortion characteristics
- Optimized design for size and performance
- Customization available
- Volume production and automated lines
- For IC manufacturer approval status, contact Midcom
- 135 ohm line






11/22/05

Details subject to change. Contact your Midcom sales representative for additional information. Dimensions: in/mm. All tolerances are ± .010/0.25 and electrical specifications are at 25°C unless otherwise specified.

Midcom, Inc. USA
 121 Airport Drive - PO Box 1330
 Watertown, SD 57201
 T: 605.886.4385 ~ F: 605.886.4486
 www.midcom-inc.com ~ email:sales@midcom-inc.com

Midcom, Inc. China
 10/F Spectrum Tower 53 Hung to Road
 Kwun Tong, Kowloon, HK
 T: 852.2320.4221 ~ F: 852.2352.3272
 www.midcom.com.cn ~ email:sye@midcom-inc.com

Globespan HDSL recommendations (continued)

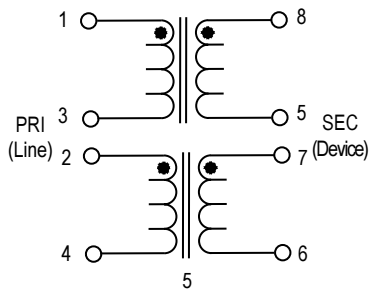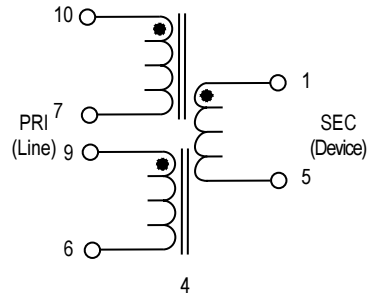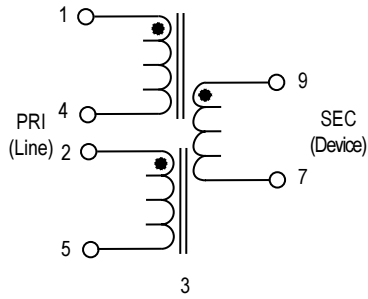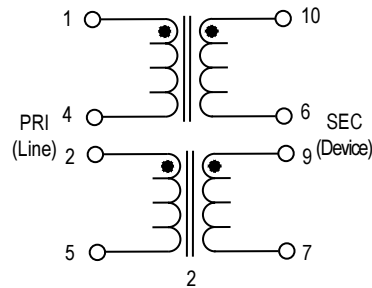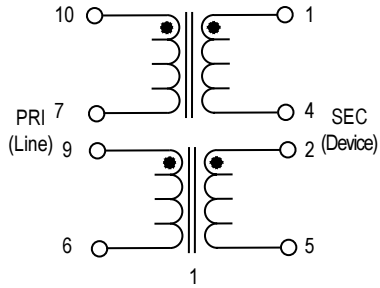

Details subject to change. Contact your Midcom sales representative for additional information. Dimensions: in/mm. All tolerances are $\pm .010/0,25$ and electrical specifications are @ 25°C unless otherwise specified.

11/22/05

