


N3100BA-9L400

N Plug Crimp Right Angle

50Ω

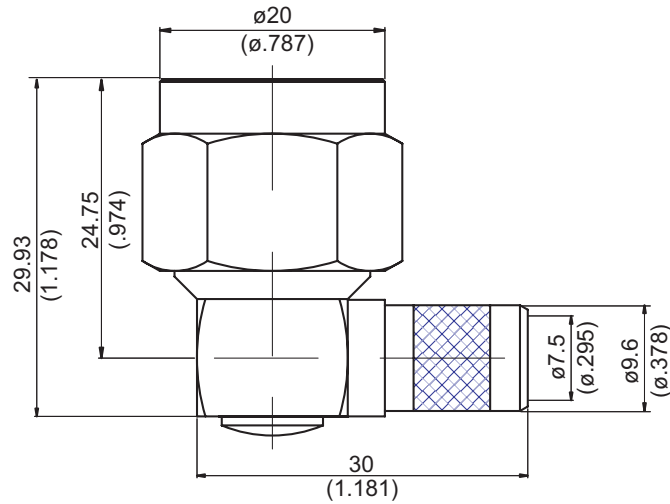

NOTE: 20 MM HEX NUT

| Parts | Material | Plating(Micro-inch) |
|---------------|----------|--|
| Contact Pin | Brass | Gold 5 Over Nickel 50 Over Copper 50 |
| Barrel | Brass | Tin-Zinc-Copper-Alloy 100 Over Copper 50 |
| Ferrule | Brass | Tin-Zinc-Copper-Alloy 100 Over Copper 50 |
| Nut | Brass | Tin-Zinc-Copper-Alloy 100 Over Copper 50 |
| Renbrock Ring | Brass | Tin-Zinc-Copper-Alloy 100 Over Copper 50 |
| Gasket | Silicon | |
| Insulator | Teflon | |
| Contact Body | Brass | Tin-Zinc-Copper-Alloy 100 Over Copper 50 |
| Body | Brass | Tin-Zinc-Copper-Alloy 100 Over Copper 50 |
| Coupling Nut | Brass | Tin-Zinc-Copper-Alloy 100 Over Copper 50 |

Weight: 57.98 g

Suitable Cables: JBY400


This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

N3100BA-9L400

JYE BAO CO., LTD.

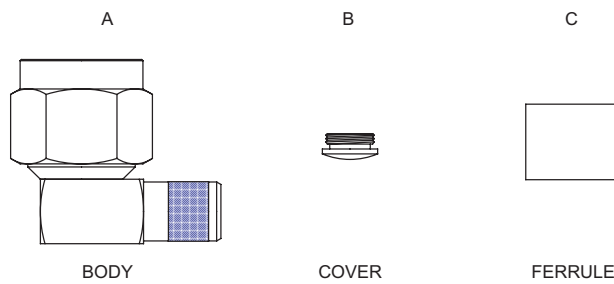

| DIAGRAM | ASSEMBLY INSTRUCTION |
|---------|---|
| | <p>Step 1: STRIP AS SHOWN .</p> |
| | <p>Step 2: SLIDE FERRULE " C " OVER CABLE . Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR " A " AND SOLDER IN "Y"</p> |
| | <p>Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP .</p> |
| | <p>Step 6: FINALLY SCREW " B " ON THE CONNECTOR BODY " A " .</p> |

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.