


N3100A-9214

N Plug Crimp Right Angle

52Ω

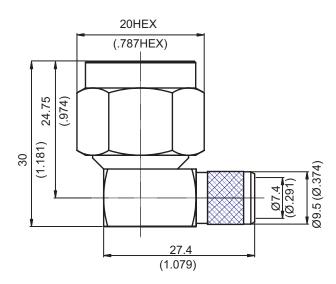

Parts	Material	Plating (Micro-inch)
Center Pin	Brass	Gold 5 Over Nickel 50 Over Copper 50
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Renbrock Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Insulator	Teflon	
Contact Body	Brass	Silver 150 Over Copper 50
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:

Suitable Cables: RG58,JBY195

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.



## CABLE ASSEMBLY INSTRUCTION N3100A-9214 JYE BAO CO., LTD. С NUT FERRULE BODY DIAGRAM ASSEMBLY INSTRUCTION Step 1: STRIP AS SHOWN. 22.4 [.883] Step 2: SLIDE FERRULE " C " OVER CABLE . Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR " A " AND SOLDER IN "Y" С Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP . Step 6: SCREW NUT " B " ON THE CONNECTOR.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.