


SSMB 3 Jack Crimp 50Ω

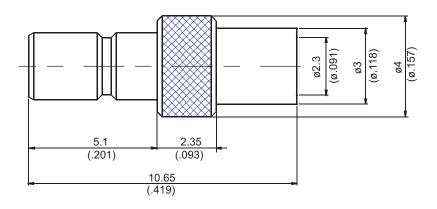

Parts	Material	Plating(Micro-inch)
Ferrule	Brass	Gold 20 Over Nickel 50 Over Copper 50
Contact Pin	Brass	Gold 20 Over Nickel 50 Over Copper 50
Insulator	Teflon	
Body	Brass	Gold 5 Over Nickel 50 Over Copper 50

Weight: 0.41 g

Suitable Cables: RG178, RG196, RG178-FEP

This Part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.



CABLE ASSEMBLY INSTRUCTION SSMB8100-0178 JYE BAO CO., LTD. С В D П **BODY CONTACT PIN INSULATOR FERRULE** DIAGRAM ASSEMBLY INSTRUCTION 4.75 Step 1: STRIP AS SHOWN. [.187] Step 2: SLIDE FERRULE " D " OVER CABLE . Step 3: WRAP THE BRAIDING OVER " D ". Step 4: STRIP AS SHOWN. [.099] [.059] D СУВ Step 5: SLIDE PREPARED CABLE INTO INSULATOR " C " . Step 6: PUT CONTACT PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y " . Step 7: PUT PREPARED CABLE INTO CONNECTOR BODY CRIMP " X " "A" AND CRIMP IN "X".

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.