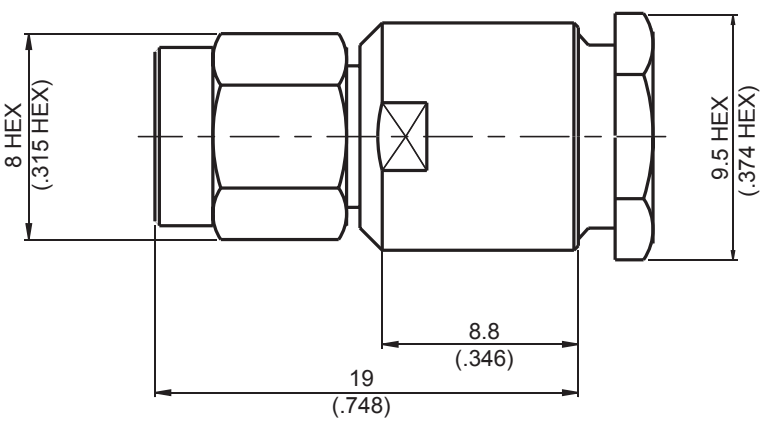


SMA3200-0142	SMA Plug Clamp	50Ω																														
																																
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <thead> <tr> <th style="width: 15%;">Parts</th> <th style="width: 20%;">Material</th> <th style="width: 65%;">Plating (Micro-inch)</th> </tr> </thead> <tbody> <tr> <td>Nut</td> <td>Brass</td> <td>Gold 5 Over Nickel 50 Over Copper 50</td> </tr> <tr> <td>Washer</td> <td>Brass</td> <td>Gold 5 Over Nickel 50 Over Copper 50</td> </tr> <tr> <td>Top Hat</td> <td>Brass</td> <td>Gold 5 Over Nickel 50 Over Copper 50</td> </tr> <tr> <td>Contact Pin</td> <td>Brass</td> <td>Gold 20 Over Nickel 50 Over Copper 50</td> </tr> <tr> <td>Renbrock Ring</td> <td>Beryllium Copper</td> <td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td> </tr> <tr> <td>Gasket</td> <td>Silicon</td> <td></td> </tr> <tr> <td>Insulator</td> <td>Teflon</td> <td></td> </tr> <tr> <td>Body</td> <td>Brass</td> <td>Gold 5 Over Nickel 50 Over Copper 50</td> </tr> <tr> <td>Coupling Nut</td> <td>Brass</td> <td>Gold 5 Over Nickel 50 Over Copper 50</td> </tr> </tbody> </table>			Parts	Material	Plating (Micro-inch)	Nut	Brass	Gold 5 Over Nickel 50 Over Copper 50	Washer	Brass	Gold 5 Over Nickel 50 Over Copper 50	Top Hat	Brass	Gold 5 Over Nickel 50 Over Copper 50	Contact Pin	Brass	Gold 20 Over Nickel 50 Over Copper 50	Renbrock Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Insulator	Teflon		Body	Brass	Gold 5 Over Nickel 50 Over Copper 50	Coupling Nut	Brass	Gold 5 Over Nickel 50 Over Copper 50
Parts	Material	Plating (Micro-inch)																														
Nut	Brass	Gold 5 Over Nickel 50 Over Copper 50																														
Washer	Brass	Gold 5 Over Nickel 50 Over Copper 50																														
Top Hat	Brass	Gold 5 Over Nickel 50 Over Copper 50																														
Contact Pin	Brass	Gold 20 Over Nickel 50 Over Copper 50																														
Renbrock Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Gasket	Silicon																															
Insulator	Teflon																															
Body	Brass	Gold 5 Over Nickel 50 Over Copper 50																														
Coupling Nut	Brass	Gold 5 Over Nickel 50 Over Copper 50																														
Weight: 6.68 g Suitable Cables: RG55, RG58, RG142, RG400, JBY195, RG142-E, RG223																																

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

SMA3200-0142

JYE BAO CO., LTD.

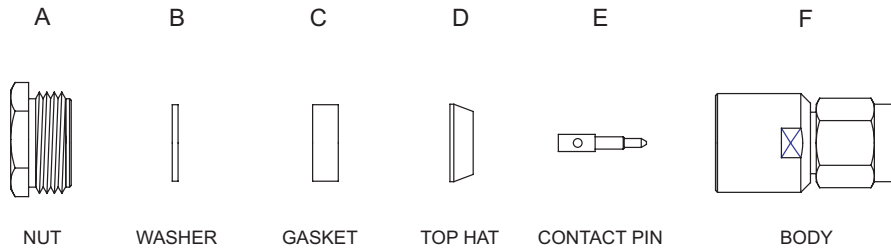
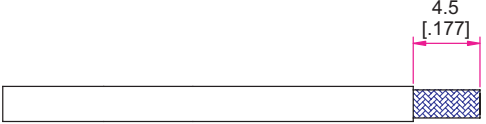
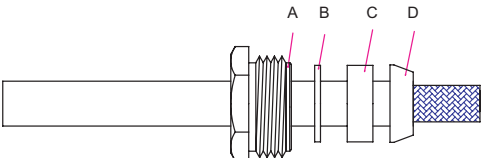
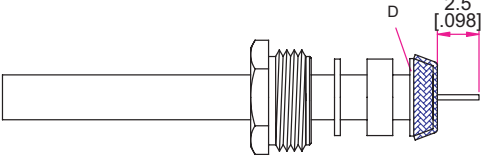
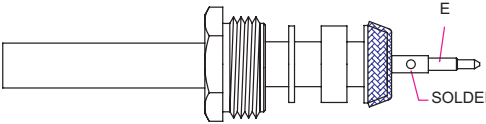
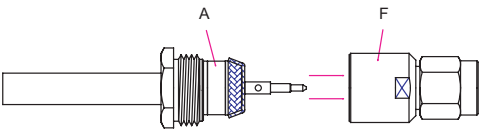


DIAGRAM	ASSEMBLY INSTRUCTION
	Step 1: STRIP AS SHOWN.
	Step 2: SLIDE "A" "B" "C" "D" OVER CABLE.
	Step 3: WRAP THE BRAIDING OVER "D". Step 4: STRIP THE DIELECTRIC AS SHOWN.
	Step 5: PUT PIN "E" IN PLACE AND SOLDER PIN "E" TO THE CENTER CONDUCTOR.
	Step 6: FINALLY SCREW "A" ON THE CONNECTOR BODY "F".

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.