

Specifications are subject to change without notice.

DESCRIPTION


The BA01207 GaAs RF amplifier designed for J-cdmaOne hand-held phone.

FEATURES

- Low voltage $V_c = 3.5V$
 - High power $P_o = 27.5dBm$
 - High gain $G_p = 27.5dB @ P_o = 27.5dBm$
 - 2stage amplifier
 - Internal input* and output matching
- *Use DC block for input port

APPLICATION

N-CDMA (Spreading chip rate is 1.2288Mcps, modulation is OQPSK) hand set.

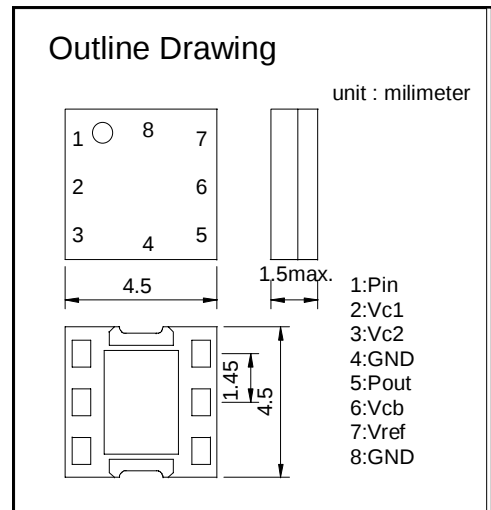

ABSOLUTE MAXIMUM RATINGS (Ta=25°C)

Symbol	Parameter	Condition	Ratings*	Unit
Vcc	Supply voltage of HPA		6	V
Pin	Input power	ZG=ZL=50Ω	7	dBm
Tc(op)	Operating case temp.		-20 ~ +85	°C
Tstg	Storage temp.		-30 ~ +125	°C

*Note : Each maximum rating is guaranteed independently .

ELECTRICAL CHARACTERISTICS(Ta=25° C , ZG=ZL=50Ω)

Symbol	Parameter	Test conditions	Limits			Unit
			MIN	TYP	MAX	
f	Frequency		887	-	925	MHz
Iq	Quiescent current	Vc=3.5V, Vcb=Vref=2.8V No Signal	-	55	70	mA
Ict ^{*1}	Total current	Po=27.5dBm (IS-95B)	-	395	420	mA
Icb+Iref	Total current	Vc1=Vc2=3.5V	-	5.3	10	mA
hadd	Power added efficiency	Vcb=Vref=2.8V	-	40	-	%
Gain	Power Gain		25	27.5	-	dB
ACP ^{*2}	Adjacent channel power at 900KHz		-	-50	-47	dBc
	Adjacent channel power at 1.98MHz		-	-60	-57	dBc
2sp	2nd harmonics		-	-30	-27	dBc
3sp	3rd harmonics		-	-45	-30	dBc
Rxnoise	Noise in RX band		-	-138	-135	dBm/Hz
Ict ^{*1}	Total current	Po=15dBm (IS-95B)	-	107	122	mA
Icb+Iref	Total current	Vc1=Vc2=1.2V	-	2.5	5.5	mA
Gain	Power Gain	Vcb=Vref=2.8V	21.5	24	-	dB
ACP ^{*2}	Adjacent channel power at 900KHz		-	-55	-47	dBc
	Adjacent channel power at 1.98MHz		-	-66	-58	dBc

*1: Ict=Ic1+Ic2, *2:ACP=ACP (30KHz band at 900/1980KHz)-Po(1.23MHz band)

Mitsubishi Electric Corporation puts the maximum effort into making semiconductor products better and reliable, but there is always the possibility that trouble may occur with them. Trouble with semiconductors may lead to personal injury, appropriate measures such as (i)placement of substitutive, auxiliary, circuits, (ii)use of non-flammable material or (iii)prevention against any malfunction or mishap.