


K3300-0118	K Plug Solder Without Pin	50Ω
------------	----------------------------------	------------

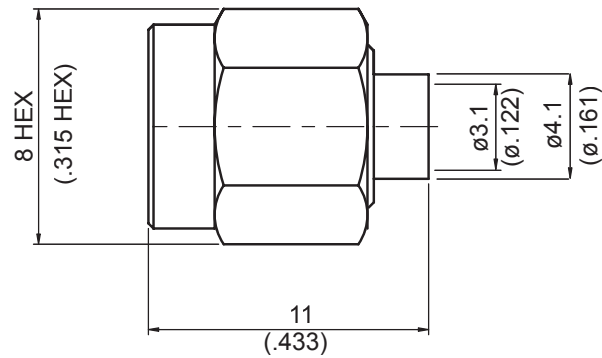

Parts	Material	Plating (Micro-inch)
Gasket	Silicon	
Renber Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Polyphenylene Oxide Noryl	
Body	Stainless	Gold 5 Over Nickel 50 Over Copper 50
Coupling Nut	Stainless	Passivated

Weight: 3.5 g
 Suitable Cables: Semi-rigid.118

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

K3300-0118

JYE BAO CO., LTD.

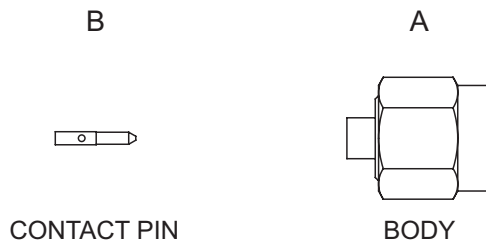


DIAGRAM	ASSEMBLY INSTRUCTION
<p style="text-align: center;">2.5 [.098]</p>	<p>Step 1: STRIP AS SHOWN .</p>
<p style="text-align: center;">B</p> <p style="text-align: center;">Y</p> <p style="text-align: center;">0.15 GAGE</p>	<p>Step 2: PUT 0.15 MM GAGE IN PLACE, INSERT CABLE'S CENTER CONDUCTOR INTO CENTER PIN " B " AND SOLDER IN " Y " .</p>
<p style="text-align: center;">ST-118</p> <p style="text-align: center;">A</p> <p style="text-align: center;">X</p> <p style="text-align: center;">ST-008</p> <p style="text-align: center;">ST-011</p>	<p>Step 3: INSERT PREPARED CABLE INTO CONNECTOR BODY " A " AND USE SOLDERING FIXTURE " ST-008 " , INSERT TOOL " ST-118 " AND LOCATOR TOOL " ST-011 " TO FIX THE CONNECTOR. SOLDER IN " X " .</p>

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.