


BNC3100-0058

BNC Plug Crimp

50Ω

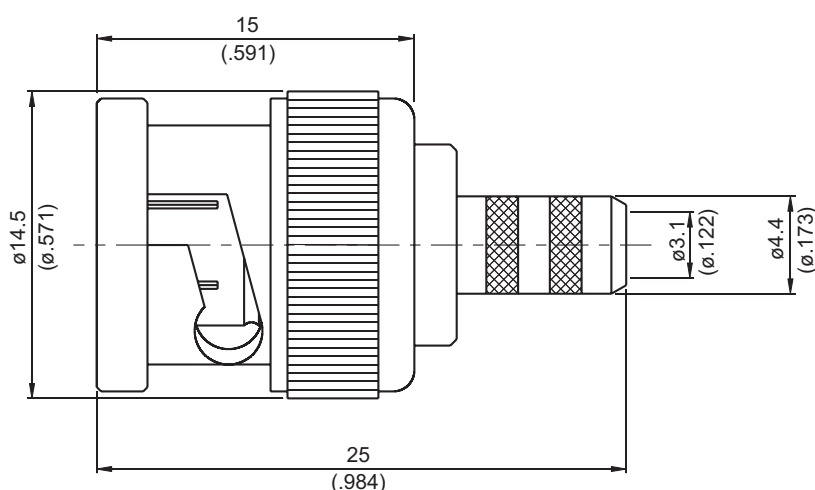

Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Gold 3 Over Nickel 50 Over Copper 50
Gasket	Silicone	
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Spring	SK5	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 9.50 g


Suitable Cables: RG58, JBY195

Notice: JYBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION


BNC3100-0058

JYE BAO CO., LTD.

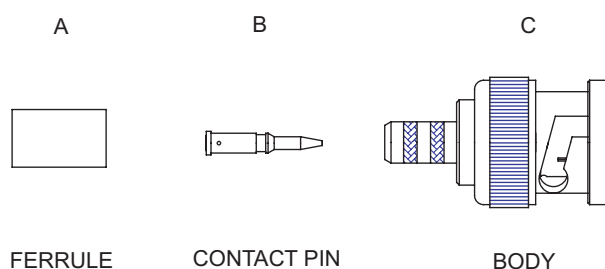


DIAGRAM


ASSEMBLY INSTRUCTION

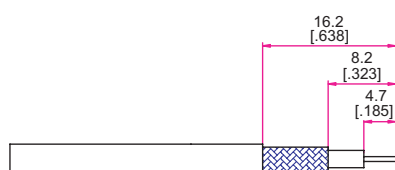


Step 1: STRIP AS SHOWN.

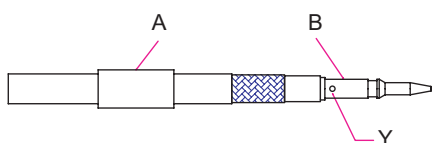

Step 2: SLIDE FERRULE "A" OVER CABLE.
Step 3: PUT PIN "B" ON CENTER CONDUCTOR AND SOLDER IN "Y".

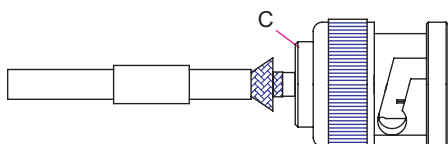

Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR "C" IN PLACE.

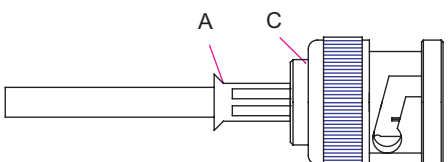

Step 5: SLIDE FERRULE "A" TOWARDS THE CONNECTOR AND CRIMP.