



FME3105W-0316

FME Plug Crimp For Bulkhead

50Ω

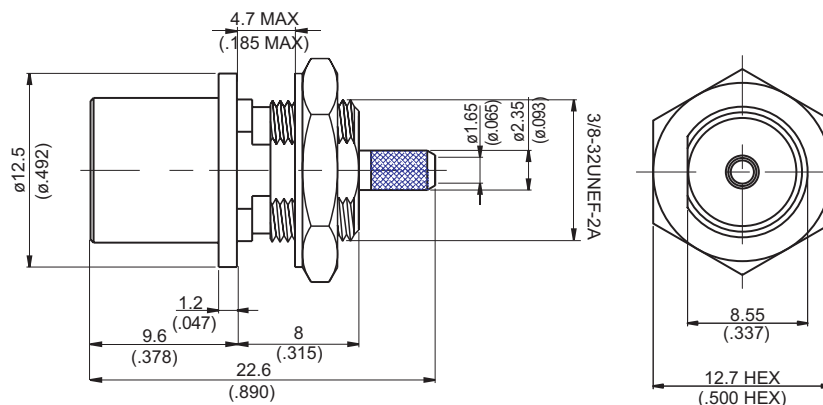

MOUNTING HOLE

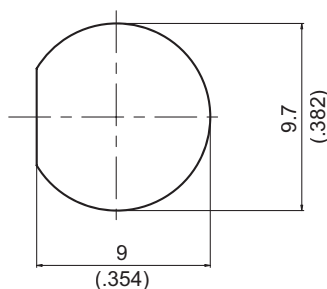

Parts	Material	Plating(Micro-inch)
Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 over Copper 50
Lock Washer	Brass	Tin-Zinc-Copper-Alloy 100 over Copper 50
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 over Copper 50
Contact Pin	Brass	Gold 3 Over Nickel 50 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 over Copper 50

Weight:

Suitable Cables: RG174, RG188, RG316, RG316-E, RG316-FEP

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

FME3105W-0316

JYE BAO CO., LTD.

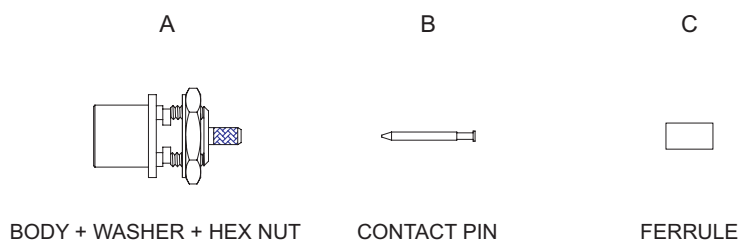

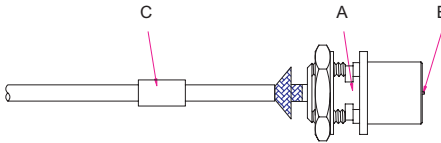
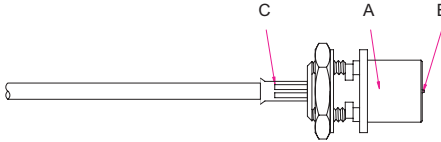


DIAGRAM	ASSEMBLY INSTRUCTION
	Step 1: STRIP AS SHOWN .
	Step 2: SLIDE FERRULE " C " OVER CABLE . Step 3: PUT CONTACT PIN " B " ON CENTER CONDUCTOR AND CRIMP IN " Y " .
	Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE .
	Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP .

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.