


MCX6100-0178 MCX Reverse Polarity Plug Crimp 50Ω

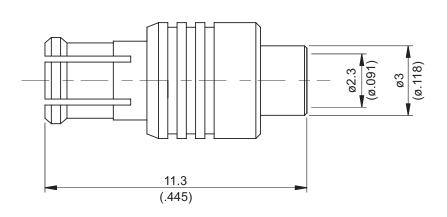

Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Gold 5 Over Nickel 50 Over Copper 50
Contact Pin	Phosphor Bronze	Gold 20 Over Nickel 50 Over Copper 50
Insulator	Teflon	
Body	Phosphor Bronze	Gold 5 Over Nickel 50 Over Copper 50

Weight: 0.87 g

Suitable Cables: RG178, RG196, RG178-FEP

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.



## CABLE ASSEMBLY INSTRUCTION MCX6100-0178 JYE BAO CO., LTD. Α CONTACT PIN **INSULATOR BODY FERRULE DIAGRAM** ASSEMBLY INSTRUCTION Step 1: STRIP AS SHOWN. 1.3 [.051] Step 2: SLIDE FERRULE "D"OVER CABLE. D Step 3: WRAP THE BRAIDING OVER " D ". 3.55 Step 4: STRIP AS SHOWN. D Step 5: SLIDE PREPARED CABLE INTO INSULATOR " C " . Step 6: PUT CONTACT PIN " B " ON CENTER CONDUCTO AND CRIMP IN " Z " OR SOLDER IN " Y " . CRIMP " X " Step 7: PUT PREPARED CABLE INTO CONNECTOR BODY "A" AND CRIMP IN "X" NOTE: CONNECTOR BARREL ALSO FUNCTIONS AS CRIMP FERRULE .

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.